

## SAFETY DATA SHEET

### Section 1. Identification

**Product identifier** : 1250004196  
**Product name** : IMRON 3460S EZ CLEARCOAT  
**Date of issue** : 6/17/2021  
**Version** : 1

#### Relevant identified uses of the substance or mixture and uses advised against

**Identified uses** : Coating component.  
**Uses advised against** : Not for sale to or use by consumers.

**Supplier's details** : Axalta Coating Systems Australia Pty Limited  
16 Darling Street, Marsden Park NSW 2765, Australia  
Importer: Resene Automotive & Light Industrial  
4 Te Apunga Place, Mt Wellington, Auckland, New Zealand  
Telephone: +64 (09) 259 2738

**Product information** : +61 (0)2 8818 4300

**Emergency telephone number** : +(64) 9801 0034 NZ Poisons Information Center: 0800 764 766 or +(64) 3 479 7248

### Section 2. Hazards identification


This material is classified as hazardous according to criteria in the Hazardous Substances (Minimum Degrees of Hazard) Regulations 2001 and has been classified according to the Hazardous Substances (Classifications) Regulations 2001.

This material is classified as DANGEROUS GOODS according to criteria in New Zealand Standard 5433:2012 Transport of Dangerous Goods on Land.

**HSNO Classification** : 3.1 - FLAMMABLE LIQUIDS - Category B  
6.1 - ACUTE TOXICITY (oral) - Category E  
6.3 - SKIN IRRITATION - Category B  
6.4 - EYE IRRITATION - Category A (Irritant)  
6.5 - SENSITIZATION - Category B (Skin)  
9.1 - AQUATIC ECOTOXICITY - Category C

#### GHS label elements

**Symbol** :

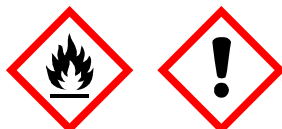

**Signal word** :

Danger

## Section 2. Hazards identification

**Hazard statements** : Highly flammable liquid and vapour.  
May be harmful if swallowed.  
Causes mild skin irritation.  
May cause an allergic skin reaction.  
Causes serious eye irritation.  
Harmful to aquatic life with long lasting effects.

### Precautionary statements

**Prevention** : Wear protective gloves. Wear eye or face protection. Keep away from ignition sources such as heat/sparks/open flame. - No smoking. Use explosion-proof electrical, ventilating, lighting and all material-handling equipment. Use only non-sparking tools. Take precautionary measures against static discharge. Keep container tightly closed. Avoid release to the environment. Avoid breathing vapour. Wash thoroughly after handling. Contaminated work clothing should not be allowed out of the workplace.

**Response** : IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water [or shower]. Wash with plenty of soap and water. If skin irritation or rash occurs: Get medical advice/attention. Wash contaminated clothing before reuse. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If eye irritation persists: Get medical advice/attention. Call a POISON CENTER or doctor/physician if you feel unwell.

**Storage** : Store in a well-ventilated place. Keep cool.

**Disposal** : Dispose of contents and container in accordance with all local, regional, national and international regulations.

**Other hazards which do not result in classification** : None known.

## Section 3. Composition/information on ingredients

**Substance/mixture** : Mixture

Ingredient name	% (w/w)	CAS number
heptan-2-one	10 - <30	110-43-0
2-ethylhexyl acetate	5 - <10	103-09-3
5-methylhexan-2-one	5 - <10	110-12-3
Naphtha (petroleum), hydrotreated heavy acetone	3 - <5	64742-48-9
Isopropyl alcohol	3 - <5	67-64-1
heptane	1 - <3	67-63-0
n-butyl acetate	1 - <3	142-82-5
bis(1,2,2,6,6-pentamethyl-4-piperidyl) sebacate	1 - <3	123-86-4
methyl 1,2,2,6,6-pentamethyl-4-piperidyl sebacate	0.3 - <1	41556-26-7
n-butyl methacrylate	0.1 - <0.3	82919-37-7
	0.1 - <0.3	97-88-1

**There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified as hazardous to health or the environment and hence require reporting in this section.**

**Occupational exposure limits, if available, are listed in Section 8.**

## Section 4. First aid measures

### Description of necessary first aid measures

- Inhalation** : Remove victim to fresh air and keep at rest in a position comfortable for breathing. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention if adverse health effects persist or are severe. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.
- Ingestion** : Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Get medical attention if adverse health effects persist or are severe. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.
- Skin contact** : Flush contaminated skin with plenty of water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Get medical attention. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.
- Eye contact** : Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Get medical attention.

### Most important symptoms/effects, acute and delayed

#### Potential acute health effects

- Inhalation** : No known significant effects or critical hazards.
- Ingestion** : May be harmful if swallowed.
- Skin contact** : Causes mild skin irritation. May cause an allergic skin reaction.
- Eye contact** : Causes serious eye irritation.

#### Over-exposure signs/symptoms

- Inhalation** : No specific data.
- Ingestion** : No specific data.
- Skin** : Adverse symptoms may include the following:  
irritation  
redness
- Eyes** : Adverse symptoms may include the following:  
pain or irritation  
watering  
redness

### Indication of immediate medical attention and special treatment needed, if necessary

- Specific treatments** : Not available.
- Notes to physician** : No specific treatment. Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been ingested or inhaled.

## Section 4. First aid measures

- Protection of first-aiders** : No action shall be taken involving any personal risk or without suitable training. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

## Section 5. Firefighting measures

### Extinguishing media

- Suitable** : Use dry chemical, CO<sub>2</sub>, water spray (fog) or foam.
- Not suitable** : Do not use water jet.
- Specific hazards arising from the chemical** : Highly flammable liquid and vapour. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. Runoff to sewer may create fire or explosion hazard. This material is harmful to aquatic life with long lasting effects. Fire water contaminated with this material must be contained and prevented from being discharged to any waterway, sewer or drain.
- Hazardous thermal decomposition products** : Decomposition products may include the following materials:  
carbon dioxide  
carbon monoxide
- Hazchem code** : Not available.
- Special precautions for fire-fighters** : Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.
- Special protective equipment for fire-fighters** : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

## Section 6. Accidental release measures

- Personal precautions, protective equipment and emergency procedures** : No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilt material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing vapour or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment (see Section 8).
- Environmental precautions** : Avoid dispersal of spilt material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air). Water polluting material. May be harmful to the environment if released in large quantities.
- Methods and material for containment and cleaning up**
- Small spill** : Stop leak if without risk. Move containers from spill area. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Use spark-proof tools and explosion-proof equipment. Dispose of via a licensed waste disposal contractor.

## Section 6. Accidental release measures

- Large spill** : Stop leak if without risk. Move containers from spill area. Approach the release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Use spark-proof tools and explosion-proof equipment. Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

## Section 7. Handling and storage

- Precautions for safe handling** : Put on appropriate personal protective equipment (see Section 8). Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Do not get in eyes or on skin or clothing. Do not ingest. Avoid breathing vapour or mist. Avoid release to the environment. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. To avoid fire or explosion, dissipate static electricity during transfer by earthing and bonding containers and equipment before transferring material. Empty containers retain product residue and can be hazardous. Do not reuse container.
- Conditions for safe storage, including any incompatibilities** : Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Eliminate all ignition sources. Separate from oxidising materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabelled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

## Section 8. Exposure controls/personal protection

### Control parameters

### Occupational exposure limits

## Section 8. Exposure controls/personal protection

Ingredient name	Exposure limits
heptan-2-one	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 50 ppm 8 hours. WES-TWA: 233 mg/m <sup>3</sup> 8 hours.
5-methylhexan-2-one	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 50 ppm 8 hours. WES-TWA: 234 mg/m <sup>3</sup> 8 hours.
acetone	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 500 ppm 8 hours. WES-TWA: 1185 mg/m <sup>3</sup> 8 hours. WES-STEL: 2375 mg/m <sup>3</sup> 15 minutes. WES-STEL: 1000 ppm 15 minutes.
Isopropyl alcohol	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 400 ppm 8 hours. WES-TWA: 983 mg/m <sup>3</sup> 8 hours. WES-STEL: 1230 mg/m <sup>3</sup> 15 minutes. WES-STEL: 500 ppm 15 minutes.
heptane	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 400 ppm 8 hours. WES-TWA: 1640 mg/m <sup>3</sup> 8 hours. WES-STEL: 2050 mg/m <sup>3</sup> 15 minutes. WES-STEL: 500 ppm 15 minutes.
n-butyl acetate	<b>NZ HSWA 2015 (New Zealand, 11/2019).</b> WES-TWA: 150 ppm 8 hours. WES-TWA: 713 mg/m <sup>3</sup> 8 hours. WES-STEL: 950 mg/m <sup>3</sup> 15 minutes. WES-STEL: 200 ppm 15 minutes.

**Appropriate engineering controls** : Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapour or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.

**Environmental exposure controls** : Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

**Individual protection measures**

**Hygiene measures** : Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.

**Respiratory protection** : Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

## Section 8. Exposure controls/personal protection

- Hand protection** : Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.
- Eye protection** : Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: chemical splash goggles.
- Skin protection** : Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear anti-static protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.

## Section 9. Physical and chemical properties

### Appearance

- Physical state** : Liquid.
- Colour** : Clear.
- Odour** : Not available.
- Odour threshold** : Not available.
- pH** : Not applicable.
- Melting point** : Not applicable.
- Boiling point** : 152 to 199.1°C (305.6 to 390.4°F)
- Flash point** : Closed cup: 15°C (59°F)
- Evaporation rate** : Not available.
- Flammability (solid, gas)** : Not available.
- Lower and upper explosive (flammable) limits** : Lower: 0.7%  
Upper: 8.1%
- Vapour pressure** : 1.5 kPa (11.4 mm Hg)
- Vapour density** : Not available.
- Density** : 0.942 g/cm<sup>3</sup>
- Solubility** : Partially soluble in the following materials: cold water.
- Partition coefficient: n-octanol/water** : Not applicable.
- Auto-ignition temperature** : 268°C (514.4°F)
- Decomposition temperature** : Not applicable.
- Viscosity** : Not available.
- Flow time (ISO 2431)** : Not available.

## Section 10. Stability and reactivity

<b>Chemical stability</b>	: The product is stable.
<b>Possibility of hazardous reactions</b>	: Under normal conditions of storage and use, hazardous reactions will not occur.
<b>Conditions to avoid</b>	: Avoid all possible sources of ignition (spark or flame). Do not pressurise, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition.
<b>Incompatible materials</b>	: Reactive or incompatible with the following materials: oxidising materials
<b>Hazardous decomposition products</b>	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

## Section 11. Toxicological information

### Information on likely routes of exposure

<b>Inhalation</b>	: No known significant effects or critical hazards.
<b>Ingestion</b>	: May be harmful if swallowed.
<b>Skin contact</b>	: Causes mild skin irritation. May cause an allergic skin reaction.
<b>Eye contact</b>	: Causes serious eye irritation.

### Symptoms related to the physical, chemical and toxicological characteristics

<b>Inhalation</b>	: No specific data.
<b>Ingestion</b>	: No specific data.
<b>Skin contact</b>	: Adverse symptoms may include the following: irritation redness
<b>Eye contact</b>	: Adverse symptoms may include the following: pain or irritation watering redness

### Delayed and immediate effects as well as chronic effects from short and long-term exposure

#### Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
heptan-2-one	LC50 Inhalation Vapour	Rat	16.8 mg/l	4 hours
	LD50 Dermal	Rabbit	10332 mg/kg	-
	LD50 Oral	Rat	1600 mg/kg	-
2-ethylhexyl acetate	LD50 Oral	Rat	3 g/kg	-
	5-methylhexan-2-one	Rat	5000 ppm	4 hours
Naphtha (petroleum), hydrotreated heavy acetone	LD50 Oral	Rat	3200 mg/kg	-
	LD50 Oral	Rat	>6 g/kg	-
	LC50 Inhalation Vapour	Rat	21 mg/l	4 hours
Isopropyl alcohol	LD50 Dermal	Rabbit	2001 mg/kg	-
	LD50 Oral	Rat	5800 mg/kg	-
	LC50 Inhalation Vapour	Rat - Male, Female	37.5 mg/l	4 hours
heptane	LD50 Dermal	Rabbit	12800 mg/kg	-
	LD50 Oral	Rat	5000 mg/kg	-
	LC50 Inhalation Gas.	Rat	48000 ppm	4 hours



## Section 11. Toxicological information

n-butyl acetate	LC50 Inhalation Vapour	Rat	103 g/m <sup>3</sup>	4 hours
	LC50 Inhalation Vapour	Rat	21.1 mg/l	4 hours
	LD50 Dermal	Rabbit	>17600 mg/kg	-
	LD50 Oral	Rat	10768 mg/kg	-
n-butyl methacrylate	LC50 Inhalation Vapour	Rat	29 mg/l	4 hours
	LD50 Dermal	Rat	17900 mg/kg	-
	LD50 Oral	Rat	16 g/kg	-

### Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
heptan-2-one	Skin - Mild irritant	Rabbit	-	24 hours 14 mg	-
2-ethylhexyl acetate	Eyes - Mild irritant	Rabbit	-	500 mg	-
	Eyes - Severe irritant	Rabbit	-	24 hours 250 ug	-
5-methylhexan-2-one	Skin - Mild irritant	Rabbit	-	500 mg	-
	Eyes - Mild irritant	Rabbit	-	24 hours 100 uL	-
acetone	Eyes - Mild irritant	Human	-	186300 ppm	-
	Eyes - Mild irritant	Rabbit	-	10 uL	-
	Eyes - Moderate irritant	Rabbit	-	24 hours 20 mg	-
Isopropyl alcohol	Eyes - Severe irritant	Rabbit	-	20 mg	-
	Skin - Mild irritant	Rabbit	-	24 hours 500 mg	-
	Skin - Mild irritant	Rabbit	-	395 mg	-
	Eyes - Moderate irritant	Rabbit	-	24 hours 100 mg	-
n-butyl methacrylate	Eyes - Moderate irritant	Rabbit	-	10 mg	-
	Eyes - Severe irritant	Rabbit	-	100 mg	-
	Skin - Mild irritant	Rabbit	-	500 mg	-
	Skin - Mild irritant	Rabbit	-	500 uL	-

### Sensitisation

Not available.

### Potential chronic health effects

<b>General</b>	: No known significant effects or critical hazards.
<b>Inhalation</b>	: No known significant effects or critical hazards.
<b>Ingestion</b>	: No known significant effects or critical hazards.
<b>Skin contact</b>	: Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
<b>Eye contact</b>	: No known significant effects or critical hazards.
<b>Carcinogenicity</b>	: No known significant effects or critical hazards.
<b>Mutagenicity</b>	: No known significant effects or critical hazards.
<b>Teratogenicity</b>	: No known significant effects or critical hazards.
<b>Developmental effects</b>	: No known significant effects or critical hazards.
<b>Fertility effects</b>	: No known significant effects or critical hazards.

## Section 11. Toxicological information

### Chronic toxicity

Not available.

### Carcinogenicity

Not available.

### Mutagenicity

Not available.

### Teratogenicity

Not available.

### Reproductive toxicity

Not available.

### Specific target organ toxicity

Name	Category	Route of exposure	Target organs
n-butyl methacrylate	Category B	Inhalation	Not determined

### Aspiration hazard

Name
Naphtha (petroleum), hydrotreated heavy

### Numerical measures of toxicity

#### Acute toxicity estimates

Route	ATE value
Oral	3020.03 mg/kg
Inhalation (gases)	55893.3 ppm
Inhalation (dusts and mists)	64.88 mg/l

## Section 12. Ecological information

**Ecotoxicity** : This material is harmful to aquatic life with long lasting effects.

### Aquatic and terrestrial toxicity

Product/ingredient name	Result	Species	Exposure
heptan-2-one 5-methylhexan-2-one acetone	Acute LC50 131000 µg/l Fresh water	Fish - Pimephales promelas	96 hours
	Acute LC50 159000 µg/l Fresh water	Fish - Pimephales promelas	96 hours
	Acute EC50 20.565 mg/l Marine water	Algae - Ulva pertusa	96 hours
	Acute LC50 4.42589 ml/L Marine water	Crustaceans - Acartia tonsa - Copepodid	48 hours
	Acute LC50 10000 µg/l Fresh water	Daphnia - Daphnia magna	48 hours
	Acute LC50 5600 ppm Fresh water	Fish - Poecilia reticulata	96 hours
	Chronic NOEC 4.95 mg/l Marine water	Algae - Ulva pertusa	96 hours
	Chronic NOEC 0.016 ml/L Fresh water	Crustaceans - Daphniidae	21 days
	Chronic NOEC 0.1 ml/L Fresh water	Daphnia - Daphnia magna - Neonate	21 days
	Isopropyl alcohol	Acute EC50 7550 mg/l Fresh water	Daphnia - Daphnia magna -

## Section 12. Ecological information

heptane	Acute LC50 1400000 µg/l Marine water Acute LC50 4200 mg/l Fresh water Acute EC50 1.5 mg/l Acute LC50 375000 µg/l Fresh water	Neonate Crustaceans - Crangon crangon Fish - Rasbora heteromorpha Daphnia - Daphnia magna Fish - Oreochromis mossambicus	48 hours 96 hours 48 hours 96 hours
n-butyl acetate n-butyl methacrylate	Acute LC50 185000 µg/l Marine water Chronic NOEC 2.6 mg/l Fresh water	Fish - Menidia beryllina Daphnia - Daphnia magna - Neonate	96 hours 21 days

### Persistence/degradability

Product/ingredient name	Aquatic half-life	Photolysis	Biodegradability
Naphtha (petroleum), hydrotreated heavy	-	-	Readily
heptane	-	70%; < 28 day(s)	Readily

### Bioaccumulative potential

Product/ingredient name	LogP <sub>ow</sub>	BCF	Potential
heptan-2-one	2.26	-	low
2-ethylhexyl acetate	4.2	-	high
5-methylhexan-2-one	1.88	-	low
Naphtha (petroleum), hydrotreated heavy	-	10 to 2500	high
acetone	-0.23	-	low
Isopropyl alcohol	0.05	-	low
heptane	4.66	552	high
n-butyl acetate	2.3	-	low
n-butyl methacrylate	2.99	-	low

### Mobility in soil




**Soil/water partition coefficient (K<sub>oc</sub>)** : Not available.

**Other adverse effects** : No known significant effects or critical hazards.

## Section 13. Disposal considerations

**Disposal methods** : The generation of waste should be avoided or minimised wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapour from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilt material and runoff and contact with soil, waterways, drains and sewers.

## Section 14. Transport information

	New Zealand Class (5433)	IMDG	IATA
UN number	UN1263	UN1263	UN1263
UN proper shipping name	PAINT	PAINT	PAINT
Transport hazard class(es)	3 	3 	3 
Packing group	II	II	II
Environmental hazards	No.	No.	No.

### Additional information

New Zealand : **Hazchem code** •3YE  
 Hazchem code : •3YE

**Special precautions for user** : **Transport within user's premises:** always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

**Transport in bulk according to IMO instruments** : Not available.

The actual shipping description for this product may vary based several factors including, but not limited to, the volume of material, size of the container, mode of transport and use of exemptions or exceptions found in the applicable regulations. The information provided in Section 14 is one possible shipping description for this product. Consult your shipping specialist or supplier for appropriate assignment information.

## Section 15. Regulatory information

**HSNO Approval Number** : HSR002662  
**HSNO Group Standard** : Surface Coatings and Colourants (Flammable)  
**HSNO Classification** : 3.1 - FLAMMABLE LIQUIDS - Category B  
 6.1 - ACUTE TOXICITY (oral) - Category E  
 6.3 - SKIN IRRITATION - Category B  
 6.4 - EYE IRRITATION - Category A (Irritant)  
 6.5 - SENSITIZATION - Category B (Skin)  
 9.1 - AQUATIC ECOTOXICITY - Category C

## Section 16. Other information

### History

<b>Date of issue</b>	: 6/17/2021
<b>Version</b>	: 1
<b>Prepared by</b>	Product stewardship and regulatory compliance.
<b>Key to abbreviations</b>	: ACGIH = Association Advancing Occupational and Environmental Health ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals HSWA = Health and Safety at Work Act 2015 IATA = International Air Transport Association IBC = Intermediate Bulk Container IMDG = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) TLV = Threshold Limit Value WES = Workplace Exposure Standards

▣ Indicates information that has changed from previously issued version.

### Notice to reader

This product is intended for industrial use only.

Safety Data Sheet (SDS) content is believed to be accurate as of its issue date, but is subject to change as new information is received by Axalta Coatings Systems, LLC or any of its subsidiaries or affiliates (Axalta). This SDS may incorporate information that has been provided to Axalta by its suppliers. Users should ensure that they are referring to the most current version of the SDS. Users are responsible for following the precautions identified in this SDS. It is the users' responsibility to comply with all laws and regulations applicable to the safe handling, use, and disposal of the product.

Users of Axalta products should read all relevant product information prior to use, and make their own determination as to the suitability of the products for their intended use. Except as otherwise required by applicable law, AXALTA MAKES NO WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. The information on this SDS relates only to the specific product identified in Section 1, Identification, and does not relate to its possible use in combination with any other material or in any specific process. If this product is to be used in combination with other products, Axalta encourages you to read and understand the SDS for all products prior to use.

© 2018 Axalta Coating Systems, LLC and all affiliates. All rights reserved. Copies may be made only for those using Axalta Coating Systems products.